

# Troubleshooting ISDN BRI Layer 3 using the debug isdn q931 Command



Help us help you.

Please rate this document.

- Excellent  
 Good  
 Average  
 Fair  
 Poor

This document solved my problem.

- Yes  
 No  
 Just browsing

Suggestions for improvement:

(256 character limit)

Optional contact information:

Name:

Email:

Send

## Contents

[Introduction](#)

[Troubleshooting Prerequisites: Activating ISDN Layer 3 debugs](#)

[Troubleshooting Overview: Symptom and Resolution Procedure](#)

[Related Information](#)

## Introduction

When troubleshooting ISDN call failure issues, it is important to keep in mind that the call could be failing due to any of the following:

- Dial-on-demand routing (DDR)
- ISDN Layers 1, 2 and 3
- Point-to-Point Protocol (PPP): including link control protocol (LCP), Authentication or IP Control Protocol (IPCP) related issues.

This document specifically focuses on ISDN related issues that cause call failures. This document also assumes that you have verified that ISDN Layers 1 and 2 on both ends of the circuit are functioning. Refer to [Using the show isdn status Command for BRI Troubleshooting](#) for more information on verifying ISDN Layer 1 and 2 status.

## Troubleshooting Prerequisites: Activating ISDN Layer 3 debugs

Use the command **debug isdn q931** on both ends to activate ISDN Layer 3 debugs. You should also have millisecond timestamps for debugs enabled on both routers. The timestamps are necessary to provide relative input to the troubleshooting process.

**Note:** Activate millisecond timestamps for debugs using the following commands:

```
maui-soho-01(config)#service timestamps debug datetime msec
maui-soho-01(config)#service timestamps log datetime msec
```

For more information on debug commands refer to [Important Information on Debug Commands](#).

## Initiate the ISDN Call

Generate an ICMP ping to the remote router IP address. This should initiate an ISDN call to that router. Both



```

.
.
.
.
.
18:39:30.000: ISDN BR0: RX <- CONNECT
      pd = 8  callref = 0x90
!-- Received a CONNECT from the remote
!-- router. The ISDN connection has been
!-- established. Any failures of the call
!-- past this point are due to higher
!-- level issues such as DDR, PPP,
!-- Authentication, IPCP/IP Addressing
18:39:30.036: ISDN BR0: TX -> CONNECT_ACK
      pd = 8  callref = 0x10
!-- The Router responds with a Connect
!-- Acknowledgment (CONNECT_ACK) to the telco.

!--- Call is accepted and the routers send
!--- a CONNECT message to the remote end
18:39:29.955: Channel ID i = 0x89
18:39:29.995: ISDN BR2/0: RX <- CONNECT_A
      pd = 8  callref = 0x08
!--- Called device receives a CONNECT_ACK
!--- from the switch
18:39:29.995:
      Channel ID i = 0x89
18:39:29.995:
      Signal i = 0x4F - Alerting off
18:39:35.655: %ISDN-6-CONNECT:
Interface BRI2/0:1 is now
connected to unknown

```

When evaluating the **debug isdn q931** output on the calling and called ends, keep the following points in mind:

- Pay attention to the direction of the messages. The debugs indicate whether the messages were generated by the router (indicated by TX ->) or if they were received by the router (indicated by RX <-). In the example below, the first message (CONNECT) is received by the router from the ISDN Switch, while the second (CONNECT\_ACK) is sent by the router:

```

18:39:30.000: ISDN BR0: RX <- CONNECT pd = 8  callref = 0x90
18:39:30.036: ISDN BR0: TX -> CONNECT_ACK pd = 8  callref = 0x10

```

You can identify the source of the problem by following the direction of a particular message and the response. For example, if the router unexpectedly receives a RELEASE message from the telco ISDN switch, then it will reset its end of the connection as well. This indicates that the issue lies with the telco ISDN switch or the remote router

- Verify that the message received or sent is the expected one. For example, if the called party receives a SETUP message but sends a DISCONNECT instead of a CONNECT, then troubleshoot the Called Router and not the ISDN network. The following table has a list of possible Q.931 messages seen during call establishment and teardown:

Message	Description
SETUP	Setup -- Indicates that a device wishes to establish a Layer 3 call.
CALL_PROC	Call Proceeding -- The call SETUP has been received and is being processed by the network and/or the remote device.
ALERTING	Alerting -- Informs the network that the end router is now 'alerting' the user; this would normally be the case for a telephone and the alert would be the "ring" on the handset. This message is normally associated with equipment using a handset, such as an ISDN telephone or TA and is not usually not seen for data calls.
CONNECT	Connect -- Call is accepted.
CONNECT_ACK	Connect Acknowledge -- The device has received the CONNECT message. The higher layer protocols (ex. PPP) should now begin negotiation
DISCONNECT	<p>Disconnect -- Router initiated Disconnect message. This message usually indicates that the ISDN circuit is functioning and that the disconnect was the result of some higher layer issues (DDR, PPP so forth and so on). The 3-way Disconnect Handshake will be accompanied by RELEASE and RELEASE_COMP messages.</p> <p>The DISCONNECT Message is also accompanied by a Disconnect Cause Code. This disconnect code can be used to pinpoint where the call was disconnected from (for example, the call was disconnected from the router, local telco switch, remote telco switch so forth and so on.). For more details refer to <a href="#">Understanding debug isdn q931 Disconnect Cause Codes</a></p>
RELEASE	<p>Release -- Acknowledges the DISCONNECT and continues circuit teardown. The RELEASE message is sandwiched between the DISCONNECT and RELEASE_COMP messages.</p> <p>The RELEASE Message may be accompanied by a Disconnect Cause Code. This disconnect code can also be used to pinpoint where the call was disconnected from (for example, the call was disconnected from the router, local telco switch, remote telco switch). For more details refer to <a href="#">Understanding debug isdn q931 Disconnect Cause Codes</a></p>
RELEASE_COMP	<p>Release Complete -- The Call teardown is complete. This message is commonly seen:</p> <ul style="list-style-type: none"> <li>a) During a normal call termination initiated by one of the routers</li> <li>b) In response to a SETUP message from the Calling Router. This is often caused by mismatch of bearer capability between the the switch and the router. A RELEASE_COMP can also be due to protocol errors if the coding of the SETUP message does not comply with the Q.931 standard or the configuration of the switch</li> </ul> <p>The RELEASE_COMP Message may be accompanied by a Disconnect Cause Code. This disconnect code can also be used to pinpoint where the call was disconnected from (for example, the call was disconnected from the router, local telco switch, remote telco switch). For more details refer to <a href="#">Understanding debug isdn q931 Disconnect Cause Codes</a></p>


## Troubleshooting Overview: Symptom and Resolution Procedure

Analyze the **debug isdn q931** output as described in the previous sections and proceed to the appropriate symptom in the table below.

**Note:** In this document, the router that initiates the call is referred to as the *Calling Router*, while the router that accepts the call is referred to as the *Called Router*.

## Symptom

The Calling Router does not send a SETUP message

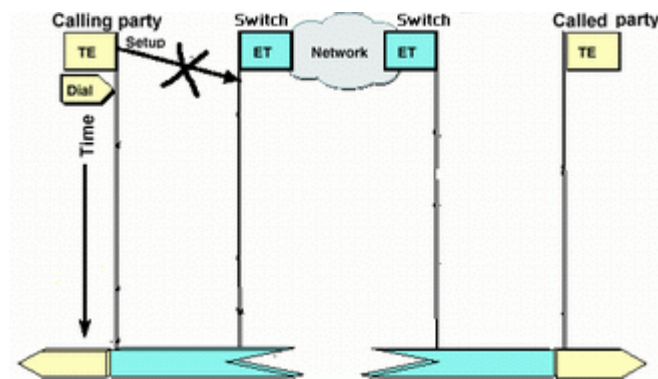

## Resolution Procedure

### On the Calling Router:

- Verify that the ISDN switchtype is correctly configured.
- Verify that the ISDN Layers 1 and 2 on the Calling Router are functioning.
- Use the **show ip route** command to verify that the router has a route to the destination and is pointing to the correct interface.
- Verify that the interesting traffic is correctly identified. For example, ICMP must be permitted if a ping should trigger the call.
- Check whether the appropriate **dialer string** (or **dialer map**) has the remote device's ISDN number. The number is required for the router to dial the link.
- Use **debug dialer** to verify that the router is initiating the call.
- Perform a loopback test call.

For more details on the above resolutions, click [here](#).


## Symptom

The Calling Router sends a SETUP message, but the Called Router does not receive it

## Resolution Procedure

### On the Called Router:

- Verify that the ISDN Switchtype is correctly configured.
- Verify that the ISDN Layers 1 and 2 on the Called Router are functioning.
- Check that the SPID Local Directory

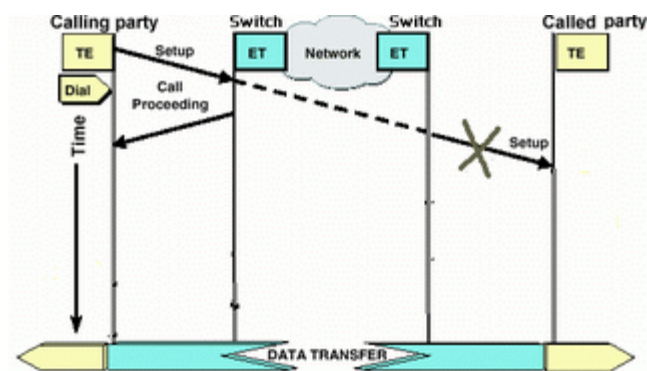

Number (LDN) is correctly configured.

#### On the Calling Router:

- Use a regular analog phone to make a test call to the remote router.
- Ensure that the destination ISDN number is configured correctly.
- Determine whether the Long Distance service (if applicable) is active. If necessary, use an alternate Long Distance Carrier or 10-10-xyz carrier.
- Configure two dialer map or two dialer string statements; one for each remote B-channel's ISDN number.

For more details on the above resolutions, click [here](#).


### Symptom

### Resolution Procedure

The Called Router receives the SETUP message does not respond with a CONNECT message.

#### On the Called Router:

- Check if the call is rejected due to Caller ID or Digital Number Identification Service(DNIS) based screening.
- Verify that the service profile identifier (SPID)s are correct.
- Ensure that there are available B-channels on the circuit that was dialed.
- If multiple BRIs are available, have the telco configure them in a hunt group.
- Check whether you are encountering bearer capability related issues.
- Interpret the disconnect cause code sent (from the Called Router to the Calling Router) in the [DISCONNECT](#) or [RELEASE](#) message.

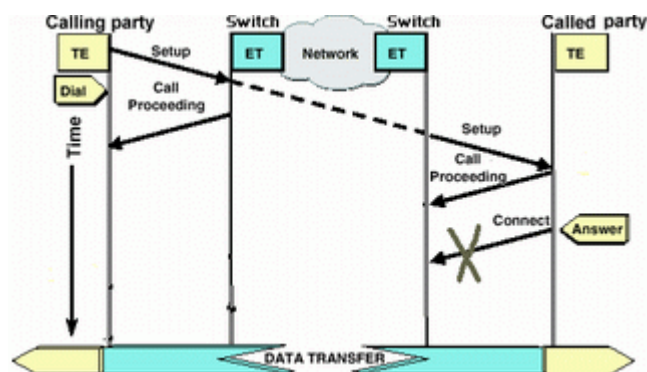

#### On the Calling Router:

- Configure two dialer map or two dialer string statements; one for each remote B-channel's ISDN number.

For more details on the above resolutions, click [here](#).


### Symptom

### Resolution Procedure

#### On the Called Router:

The Called Routers sends a CONNECT message but the Calling Router does not receive it

- Determine whether the router receives a CONNECT\_ACK from the local ISDN switch

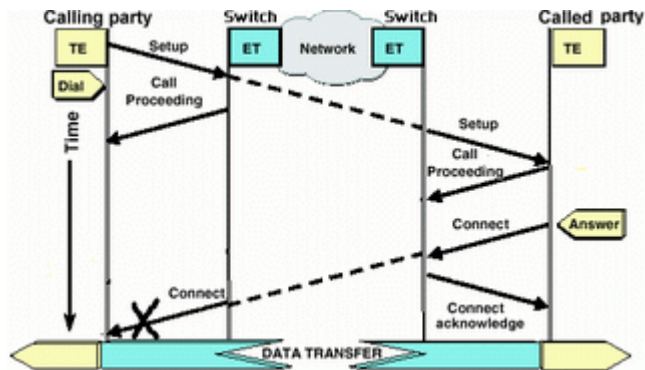

Contact the telco for further Troubleshooting.

For more details on the above resolutions, click [here](#).

## Symptom

The Calling Router receives a CONNECT but the call still fails

## Resolution Procedure

- Contact the telco to determine if there is a problem with the B-Channel not being properly mapped across for data.
- The problem involves a higher level protocol such as PPP, IP addressing so on and so forth.

For more details on the above resolutions, click [here](#).

# Troubleshooting: Symptom and Detailed Resolution Procedure

## The Calling Router does not send a SETUP message

If the Calling Router does not send a SETUP message to the ISDN network, the problem is likely related to ISDN layers 1, 2 or Dial-on-Demand Routing (DDR) issues, and is not layer 3 related

Perform the following tasks on the Calling Router:

- Verify that the ISDN switchtype is correctly configured:

The ISDN switchtype can be verified using the command [show isdn status](#). The telco should explicitly indicate the switchtype that needs to be configured. Occasionally (especially in North America) the telco may indicate the switchtype is "custom" or "national". In such cases, use the following guidelines to determine the switchtype configuration:

**Custom:** If the telco indicates that their switch-type is Custom, then configure the switchtype on the router as basic-5ess (for BRI with 5ess switch), primary-5ess (for PRI with 5ess), basic-dms (for BRI with DMS switch), or

primary-dms (for PRI with DMS).

**National:** Switchtype conforming to the NI-1 standard for BRI and NI-2 standard for PRI (there is no NI-1 standard for PRIs) . If the telco informs you that the switchtype is National, then the Cisco router configuration should be basic-ni (for BRI) or primary-ni (for PRI).

To configure the switchtype use the command **isdn switch-type** *switch-type* in the BRI interface configuration mode. For an example refer to [Troubleshooting ISDN BRI Layer 1](#)

- Verify that the ISDN Layers 1 and 2 on the Calling Router are functioning:

You can verify that ISDN Layers 1 and 2 are up using the command **show isdn status**. Use the procedure outlined in [Using the show isdn status Command for BRI Troubleshooting](#) to troubleshoot ISDN Layer 1 and 2 related issues.

- Use the **show ip route** command to verify that the the router has a route to the destination.

The **show ip route** command will indicate whether there is a route to the remote router network. If the route does not exist, use the **ip route** command to add a static route for the remote network. Make sure the route points to the correct interface on the Calling Router.

In a legacy DDR environment (for example, dialer maps) the next hop should be either the physical interface network (**interface BRI x**) or the remote router IP address (which should also have been configured in the **dialer map** statement).

With Dialer Profiles, the next hop is usually the **interface Dialer x** used for the dialout. For example,

```
maui-soho-01#show ip route
...
...!-- Output omitted
...

      10.0.0.0/24 is subnetted, 1 subnets
C       10.0.0.0 is directly connected, Ethernet0
S*     0.0.0.0/0 is directly connected, Dialer1
```

In the example above, note that the default route next hop is **interface Dialer 1** (the logical dialer interface for this connection).

- Verify that the interesting traffic is correctly identified.

The router checks to verify that an incoming packet is interesting traffic before initiating the dial. Hence, the router may not dial if the interesting traffic is incorrectly defined, or if the **dialer-list number** (the interesting traffic definition) is not applied to the physical or dialer interface (using the **dialer-group number** command). For example, if you are using an ICMP ping to initiate the DDR connection, verify that the ICMP is permitted in the interesting traffic definition.

Refer to [Configuring BRI-to-BRI Dialup with DDR Dialer Maps](#) for more information.

- Check whether the appropriate **dialer string** (or **dialer map**) includes the remote device's ISDN number.

The dialer string (or dialer map) must include the remote router's ISDN number. For example,

```
dialer string 5551111
or
dialer map ip 172.20.10.1 name maui-nas-05 broadcast 5551111
```

- Check the DDR configuration and use **debug dialer** to verify that the router is initiating the call:

Verify that the DDR configuration is correct. Use the document [Dialup Technology: Overviews and Explanations](#) for further assistance on the correct DDR configuration.

You should also use the command **debug dialer** to verify that the router receives interesting traffic and has the appropriate dialer map or dialer string to initiate the dial. Refer to the document above as well as [Dialup Technology: Troubleshooting Techniques](#) for more information.

Refer to the following sample configuration for examples of proper DDR configuration:

Dialer Profiles: [Configuring ISDN DDR with Dialer Profiles](#)

Legacy DDR(Dialer Maps): [Configuring BRI-to-BRI Dialup with DDR Dialer Maps](#)

**Tip:**For testing purposes, you can eliminate DDR by using the **isdn call** command (explained in the next section) to generate an ISDN call to the remote device. If that call succeeds then you can be reasonably sure that the ISDN circuit is functioning. Continue troubleshooting DDR.

- Perform a loopback test call

In a loopback call, the router dials the ISDN number of its own BRI. The call proceeds to the telco cloud, where the telco switches the call to the second BRI channel. This call is now seen by the router as an incoming call on the second channel. Therefore, the router both sends and receives the ISDN call.

A loopback call tests the ability of the router to initiate and terminate an ISDN call. A successful loopback call gives you a strong indication that the ISDN circuit to the telco cloud is functioning correctly.

The following is an annotated example of a successful loopback call. The command **isdn call** (introduced in Cisco IOS® software 12.0(3)T) enables outgoing isdn calls without requiring the DDR requirements such as interesting traffic and routes. This command can only be used for testing of the ISDN circuit and cannot be used to pass traffic or as a substitution for a proper DDR configuration. This command allows us to verify that the ISDN circuit, especially Layer 3, is functioning.

```
maui-soho-04#isdn call interface bri 0 5551111
!--- the router will dial 5551111 (the ISDN number of the router's own BRI)
maui-soho-04#
*Mar  1 17:55:08.344: ISDN BR0: TX ->  SETUP pd = 8  callref = 0x09
!--- Q931 Setup message is Transmitted (TX) to the telco switch
*Mar  1 17:55:08.360:          Bearer Capability i = 0x8890
*Mar  1 17:55:08.360:          Channel ID i = 0x83
*Mar  1 17:55:08.364:          Keypad Facility i = '5551111'
*Mar  1 17:55:08.484: ISDN BR0: RX <-  CALL_PROC pd = 8  callref = 0x89
!--- Call Proceeding message is Received (RX) from the telco switch.
!--- The switch is now processing the call.
*Mar  1 17:55:08.488:          Channel ID i = 0x89
*Mar  1 17:55:08.516: ISDN BR0: RX <-  SETUP pd = 8  callref = 0x12
```

```

!--- A Setup message is Received (RX) from the switch. This message is for the
!--- incoming call. Remember that the router sent a Setup message (for the
!--- outgoing call) and now receives a SETUP message for the same call
*Mar 1 17:55:08.516:          Bearer Capability i = 0x8890
*Mar 1 17:55:08.520:          Channel ID i = 0x8A
*Mar 1 17:55:08.520:          Signal i = 0x40 - Alerting on - pattern 0
*Mar 1 17:55:08.532:          Called Party Number i = 0xC1, '5551111'
*Mar 1 17:55:08.532:          Locking Shift to Codeset 5
*Mar 1 17:55:08.532:          Codeset 5 IE 0x2A i = 0x808001038001118001, '<'
*Mar 1 17:55:08.564: ISDN BR0: Event: Received a DATA call from on B2 at 64 Kb/s
*Mar 1 17:55:08.620: %DIALER-6-BIND: Interface BRI0:2 bound to profile Dialer1
*Mar 1 17:55:08.652: ISDN BR0: TX -> CALL_PROC pd = 8 callref = 0x92
!--- Transmit (TX) a Call Proceeding message for the incoming call
*Mar 1 17:55:08.652:          Channel ID i = 0x8A
*Mar 1 17:55:08.700: %LINK-3-UPDOWN: Interface BRI0:2, changed state to up
*Mar 1 17:55:08.988: ISDN BR0: TX -> CONNECT pd = 8 callref = 0x92
!--- Transmit (TX) a Connect message for the incoming call
*Mar 1 17:55:08.988:          Channel ID i = 0x8A
*Mar 1 17:55:09.040: ISDN BR0: RX <- CONNECT_ACK pd = 8 callref = 0x12
!--- Receive (RX) a Connect Acknowledgment for the incoming call
*Mar 1 17:55:09.040:          Channel ID i = 0x8A
*Mar 1 17:55:09.040:          Signal i = 0x4F - Alerting off
*Mar 1 17:55:09.064: ISDN BR0: RX <- CONNECT pd = 8 callref = 0x89
!--- Receive (RX) a Connect for the outgoing call
*Mar 1 17:55:09.076: ISDN BR0: TX -> CONNECT_ACK pd = 8 callref = 0x09
*Mar 1 17:55:09.080: %LINK-3-UPDOWN: Interface BRI0:1, changed state to up
*Mar 1 17:55:09.104: %DIALER-6-BIND: Interface BRI0:1 bound to profile BRI0
*Mar 1 17:55:09.112: %ISDN-6-CONNECT: Interface BRI0:1 is now connected to 5551111
!--- Call is now connected. Loopback call is successful

```

### Notes:

- During the loopback call, the router performs as both the Called Router as well as the Calling Router (albeit on different B-channels). It is important that you keep track of these "dual roles" when interpreting the **debug isdn q931** output. For example, the router transmits a setup message (**TX -> SETUP**) and receives one as well (**RX <- SETUP**). The transmitted SETUP should be associated with the outgoing call while the received SETUP message is associated with the incoming call.
- In the above example, we dialed the number for the first B-channel. However, the telco recognizing that the first B-channel was busy (since it was making the call), switched the call to the second B-channel and the connection was completed successfully. However, a misconfiguration in the telco switch can result in a failure of the loopback call, due to the switch trying to assign the call to the first channel (which is busy making the call). The telco should correct this problem. However, as a workaround solution specify the second B-channel number in the command **isdn call**.
- If the loopback call succeeds and the call to the remote end continues to fail, contact the telco for further troubleshooting assistance with your BRI circuit.

### The Called Router does not receive a SETUP message

If you determine that the Calling Router sends an ISDN Layer 3 SETUP message, but that the Called Router does not receive it, then the issue could be with ISDN layers 1 and 2 on the Called Router or it could be a problem with the telco ISDN cloud.

Perform the following tasks on the Called Router:

- Verify that the ISDN switchtype is correctly configured:

The ISDN switchtype can be verified using the command [show isdn status](#). The telco

should explicitly indicate the switchtype that needs to be configured. Occasionally (especially in North America) the telco may indicate the switchtype is "custom" or "national". In such cases, use the following guidelines to determine the switchtype configuration:

**Custom:** If the telco indicates that their switch-type is Custom, then configure the switchtype on the router as basic-5ess (for BRI with 5ess switch), primary-5ess (for PRI with 5ess), basic-dms(for BRI with DMS switch), or primary-dms (for PRI with DMS).

**National:** Switchtype conforming to the NI-1 standard for BRI and NI-2 standard for PRI (there is no NI-1 standard for PRIs) . If the telco informs you that the switchtype is National, then the Cisco router configuration should be basic-ni (for BRI) or primary-ni (for PRI).

To configure the switchtype use the command **isdn switch-type** *switch type* in BRI interface configuration mode. For an example refer to [Troubleshooting ISDN BRI Layer 1](#)

- Verify that the ISDN Layers 1 and 2 on the Calling Router are functioning:

You can verify that ISDN Layers 1 and 2 are up using the command **show isdn status**. Use the procedure outlined in [Using the show isdn status Command for BRI Troubleshooting](#) to troubleshoot ISDN Layer 1 and 2 related issues.

- Verify that the SPID Local Directory Number (LDN) is correctly configured

Certain switchtypes require that the spid and ldn are correctly configured in order to accept incoming calls. Refer to [Troubleshooting ISDN BRI SPIDs](#) for more information.

Perform the following tasks on the Calling Router:

- Use a regular analog phone to make a test call to the remote router.

Using a regular analog phone, dial the ISDN number of the Called Router exactly as it is configured on the Calling Router. The Called Router should receive a SETUP message (though the call will later fail since it is not an ISDN call). If the Called Router receives the SETUP message then we can assume that the Called side ISDN network is functioning. The issue could be with the local side ISDN network, the destination ISDN number, the Long distance service, so forth and so on. Proceed using the steps below.

- Ensure that the destination ISDN number is configured correctly:

Check the Calling Router configuration and verify that the ISDN number configured for the remote router is correct. Very often ISDN circuits behind a PBX require a 9 preceding the ISDN number. Also, if the call is long distance (in the US), then you should include the digit 1 before the remote site ISDN number (similar to normal phone long distance dialing) . For example, consider a situation where the local site is behind a PBX and the call to the remote site needs to be a long distance call. The remote end ISDN number is 5551111 within area code 512. In this case, including the appropriate digits for the PBX and long distance, the number dialed is 915125551111.

The **debug isdn q931** disconnect reason can also be used to determine whether the call

failure is due to, an incorrect remote ISDN number or due to an improperly formatted number. Refer to the document [Understanding debug isdn q931 Disconnect Cause Codes](#) for more information on interpreting ISDN q931 disconnect cause codes.

A disconnect due to an incorrect ISDN number may be indicated with:

```
Aug 13 18:20:01.100: ISDN BR0: RX <- DISCONNECT pd = 8 callref = 0x85
Aug 13 18:20:01.112: Cause i = 0x81D8 - Incompatible destination
```

Referring to the Disconnect Cause codes document referenced previously, we can determine that the disconnect code was caused by an attempt to connect to a non-ISDN equipment. (For example, an analog line.).


A disconnect due to an improperly formatted number may be indicated with:

```
Aug 13 18:23:14.734: ISDN BR0: RX <- RELEASE_COMP pd = 8 callref = 0x86
Aug 13 18:23:14.742: Cause i = 0x829C - Invalid number format (incomplete number
```

Referring to the document [Understanding debug isdn q931 Disconnect Cause Codes](#), we can determine that the disconnect code was caused by an invalid format for the remote ISDN number. The connection fails because the destination address is presented (to the switch) in an unrecognizable format, or the destination address is incomplete.

- If applicable, determine whether the Long Distance service is active:

You should contact your local telco and long distance provider to verify that the service is activated. Often, the local telco has the ISDN circuit misconfigured such that outbound ISDN long distance calls are not switched over to the appropriate long distance provider network. You should also verify that the long distance providers network is functioning.

In the US and in situations where the telco/long distance provider is unable to rectify the problem, you may wish to use a Presubscribed Interexchange Carrier (PIC). PIC codes are 7-digit prefixes which identify US long distance carriers to the local exchange carriers (LEC). This allows customers to use different long-distance carriers for separate calls. The PIC code is configured as a prefix to the dialed number. Most PICs are of the format 1010xxx. For a numerical listing of PICs refer to [US PIC codes, Numerically](#) 

- Configure two dialer map or two dialer string statements; one for each remote B-channel's ISDN number:

Configuring a dialer map (or a dialer string, if using dialer profiles) for each remote B-channel allows the connection to proceed even if the telco is not capable of switching the second call to the second ISDN B-channel.

**Note:** This workaround is required if only 1 B-channel is accepting calls on a given BRI. This issue is often seen with multilink connections.

A sample configuration (using dialer maps) is provided:

```
dialer map ip 172.20.10.1 name maui-nas-05 broadcast 5551111
dialer map ip 172.20.10.1 name maui-nas-05 broadcast 5551112
!--- dialer map statements for the remote router
!--- The two different phone numbers correspond
!--- to the b-channels of the remote side. The multiple statements allow
!--- the router to dial the second number if the first number is busy.
```

## The Called Router does not send a CONNECT message

If the Called Router receives a SETUP message but does not respond with a CONNECT message, then this could indicate that the router (for some undetermined reason) choose not to accept the call.

Perform the following tasks on the Called Router:

- Check if the call is rejected due to Caller ID/DNIS based screening:

Caller ID or DNIS based screening permits the router to selectively accept or deny a particular calls without incurring toll charges. With Caller ID based screening, the Called Router receives (in the SETUP message) the number of the Calling Party. This allows the router to permit calls from certain numbers thus providing some security. With DNIS based screening the Called Router discriminates incoming calls based on the number dialed.

There are a couple of main points to remember regarding CLID/DNIS based screening:

- 1) The telco must provide the appropriate CLID/DNIS information in the SETUP message. If you enable Caller ID screening on the router, but do not have Caller ID digits being passed to the router, then all calls to the router will be "screened" and no calls will be accepted.
- 2) Check the format of the CLID/DNIS digits delivered by the telco (in the **debug isdn q931** output). For example, some telcos include the area code in the delivered CLID/DNIS digits, while others do not. Correct any CLID/DNIS configuration as appropriate.

The following is an example of a failed call. The router has CLID based screening enabled, however, since the telco does not deliver the CLID digits the router rejects the call.

```
maui-nas-08#
05:46:33: ISDN BR2/0: RX <- SETUP pd = 8 callref = 0x4E
! --- The router receives (RX) a SETUP message
05:46:33: Bearer Capability i = 0x8890
05:46:33: Channel ID i = 0x89
05:46:33: Signal i = 0x40 - Alerting on - pattern 0
05:46:33: Called Party Number i = 0xC1, '5558888', Plan:ISDN,
Type:Subscriber(local)
! --- The Called Number (DNIS) is delivered to the router
! --- Note that CLID information is not delivered
05:46:33: Locking Shift to Codeset 5
05:46:33: Codeset 5 IE 0x2A i = 0x808001038001118001, '<'
05:46:33: ISDN BR2/0: TX -> RELEASE_COMP pd = 8 callref = 0xCE
05:46:33: Cause i = 0x8095 - Call rejected
! --- Calls is Rejected due to screening
```

For more information on Caller ID refer to the document [ISDN Authentication and Callback with Caller ID](#)

- Verify that the SPIDs are correct:

Use the **show isdn status** command to verify that the SPIDs on the Called Router is correct. Refer to [Using the show isdn status Command for BRI Troubleshooting](#) for further information on troubleshooting Spid related Issues.

- Ensure that there are available B-channels on the circuit that was dialed:

Use the **show isdn status** command to check if there are any available channels on the circuit

that was dialed. If there are no available channels use the **clear** command to free up some channels.

- If multiple BRIs are available, have the telco configure them in a hunt group:

Having multiple BRIs in a hunt group allows for the telco to switch the call to any free BRI circuit on that router. Contact the telco for this feature.

- Check whether you are encountering bearer capability related issues:

The Bearer Capability (or bearer cap) is the layer 3 service indication which defines the characteristics of a given call. The Bearer Cap of a call is indicated by the telco in the Q.931 SETUP messages. The Bearer cap is often used to distinguish among 64k voice (analog), 56k data calls and 64k data calls. The most commonly seen bearer cap messages and their descriptions are provided below:

<b>Bearer Cap</b>	<b>Description</b>
0x8890	ISDN 64K call
0x8890218F	ISDN 56K call
0x8090A2	Voice/Speech call (u-law)
0x9090A2	Voice/Speech call (u-law) - 3.1 kHz Audio
0x8090A3	Voice/Speech call (A-law)
0x9090A3	Voice/Speech call (A-law) - 3.1 kHz Audio

The following is an example of a ISDN 64k call:

```
Aug  8 18:49:48.246: ISDN BR2/0: RX <-  SETUP pd = 8  callref = 0x6F
!-- Incoming SETUP messages
Aug  8 18:49:48.246:          Bearer Capability i = 0x8890
!-- The bearer cap indicates the incoming call is ISDN 64k
Aug  8 18:49:48.246:          Channel ID i = 0x89
...
...
```

Follow the steps below depending on the bearer cap of the call:

#### **Bearer Capability is 0x8890218F: The call is ISDN 56K digital :**

- Verify that the ISDN switctype is correctly configured:

The ISDN switctype can be verified using the command [show isdn status](#). The telco should explicitly indicate the switctype that needs to be configured. Occasionally (especially in North America) the telco may indicate the switctype is "custom" or "national". In such cases, use the following guidelines to determine the switctype configuration:

**Custom:** If the telco indicates that their switch-type is Custom, then configure the switctype on the router as basic-5ess (for BRI with 5ess switch), primary-5ess (for PRI with 5ess), basic-dms(for BRI with DMS switch), or primary-dms (for PRI with DMS).

**National:** Switctype conforming to the NI-1 standard for BRI and NI-2 standard for PRI (there is no NI-1 standard for PRIs) . If the telco informs you that the switctype is National, then the Cisco router configuration should be basic-ni (for BRI) or primary-ni

(for PRI).

To configure the switchtype use the command **isdn switch-type** *switch type* in BRI interface configuration mode. For an example refer to [Troubleshooting ISDN BRI Layer 1](#)

- On the dialing side, verify that the speed/rate of the call is 56k. This is necessary because some legacy ISDN switches may not be passing clear channel and may force you to make your call at 56K to get through.

Use the **speed** parameter on the **dialer map** configuration command to make outgoing calls at 56 Kbps as shown in the following example:

```
maui-soho-01(config)#interface bri 0
maui-soho-01(config-if)#dialer map ip 10.1.1.1 name Maui-NAS-08 speed 56 5551111
!-- The keyword speed 56 sets the outgoing call rate at 56k
```

The following example illustrates how to configure a Cisco IOS dialer profile to make outgoing calls at 56 Kbps:

```
maui-soho-01(config)#interface dialer 1
maui-soho-01(config-if)#dialer string 5558888 class 56k
!-- Use the map-class named "56k" when dialing number 5558888
maui-soho-01(config-if)#exit
maui-soho-01(config)#map-class dialer 56k
!-- map-class named "56k" that was used with the dialer string above
maui-soho-01(config-map-clas)#dialer isdn speed 56
!-- Set the speed of the call to be 56k (default is 64k)
```

- On the receiving side, configure the command **isdn not-end-to-end 56** under the BRI interface.

```
Maui-NAS-08(config)#interface bri 2/0
Maui-NAS-08(config-if)#isdn not-end-to-end 56
```

The ISDN Q.931 bearer capability and other Information Element (IE)s are used to determine the speed of the incoming call and in most circumstances will operate properly. However, in some country-to-country applications (or due to some legacy switches), the incoming call setup message will be delivered with a bearer capability that does not match the originating call. If a message indicating isdn 'not end-to-end' is received, the router can override the received bearer capability using the Cisco IOS configuration command **isdn not end-to-end**.

**Bearer Capability is 0x8090A2 or 0x9090A2: Voice/Speech call (u-law)**

**Bearer Capability is 0x8090A3 or 0x9090A3: Voice/Speech call (A-law)**

The incoming call is a 64k Analog Call. For modem applications the call will be sent to the internal modems, while for voice applications the call may be sent to the appropriate voice module. Perform the following steps:

1. On the receiving side, verify that the ISDN physical interface (for example, **interface bri 0**) has **isdn incoming-voice modem** configured.
2. Verify that the modem lines have the command **modem inout**.

For an example configuration refer to the document [Configuring Modem Connectivity with a Cisco 3640 BRI](#)

- Interpret the disconnect cause code sent (from the Called Router to the Calling Router) in the

## [DISCONNECT](#) or [RELEASE](#) message

If the Called Router does not send a CONNECT message to the Calling Router, it should send back either a DISCONNECT or RELEASE message. This DISCONNECT or RELEASE message should also include a Disconnect cause code. In the example below, the Disconnect cause code is 0x8090. Refer to the document [Understanding debug isdn q931 Disconnect Cause Codes](#) to interpret the disconnect code.

```
Aug 22 19:25:24.290: ISDN BR0: TX -> DISCONNECT pd = 8 callref = 0x06
Aug 22 19:25:24.298: Cause i = 0x8090 - Normal call clearing
```

## The Calling Router does not receive a CONNECT message

If the Called Router sends a CONNECT message, but that message is not received by the Calling Router, then the issue most likely lies with the telco.

- Determine whether the router receives a CONNECT\_ACK from the local ISDN switch:

This indicates the the telco switch near the Called Router accepted the CONNECT message and is passing the CONNECT message to the Calling Router. A failure of the call is likely a telco issue.

- Contact the telco for further troubleshooting.

## The Calling Router receives a CONNECT but the call still fails

If the Calling Router receives a CONNECT message, that indicates that the ISDN connection is active and functioning correctly. Any failure of the call, past this stage, is due to a higher layer issue such as with PPP, Authentication or IPCP/IP Address negotiation. Use **debug ppp negotiation** for further ppp troubleshooting.

You should also consult the document [Dialup Technology: Troubleshooting Techniques](#) for further PPP troubleshooting techniques.

---

## Related Information

- [Access-Dial Technical Tips](#)
- [Access Products Support Page](#)
- [Access Technology Support Page](#)

---

<a href="#">Home</a>	<a href="#">What's New</a>	<a href="#">How to Buy</a>	<a href="#">Login</a>	<a href="#">Register</a>	<a href="#">Feedback</a>	<a href="#">Search</a>	<a href="#">Map/Help</a>
----------------------	----------------------------	----------------------------	-----------------------	--------------------------	--------------------------	------------------------	--------------------------

All contents are Copyright © 1992--2001 Cisco Systems Inc. All rights reserved. [Important Notices](#) and [Privacy Statement](#).